

TEST REPORT



Intertek

REPORT NUMBER: 3179554-SAT-A
ORIGINAL ISSUE DATE: May 29, 2009
REVISED DATE: N/A

EVALUATION CENTER
Intertek Testing Services NA Inc.
16015 Shady Falls Rd.
Elmendorf, TX 78112

RENDERED TO

TPR² Corporation
161 Interstate Lane
Waterbury, CT 06705

PRODUCT EVALUATED: Heatlok soy 2lb closed cell foam 9 " sidewalls and 13" ceiling rafters coated with 14 mils of Fireshell® F10E intumescent coating
EVALUATION PROPERTY: Heat Release, Flame Spread

Report of testing Heatlok Soy 2lb closed cell foam with 14 mils of Fireshell® F10E for compliance with the applicable requirements of the following criteria: NFPA 286 with the acceptance criteria of ICC-ES ACC377 Appendix A

This report is for the exclusive use of Intertek's Client and is provided pursuant to the agreement between Intertek and its Client. Intertek's responsibility and liability are limited to the terms and conditions of the agreement. Intertek assumes no liability to any party, other than to the Client in accordance with the agreement, for any loss, expense or damage occasioned by the use of this report. Only the Client is authorized to copy or distribute this report and then only in its entirety. Any use of the Intertek name or one of its marks for the sale or advertisement of the tested material, product or service must first be approved in writing by Intertek. The observations and test results in this report are relevant only to the sample tested. This report by itself does not imply that the material, product, or service is or has ever been under an Intertek certification program.

1 Table of Contents

INTRODUCTION	3
TEST SAMPLES	3
TESTING AND EVALUATION METHODS	3
TESTING AND EVALUATION RESULTS	6
CONCLUSIONS	7
APPENDICES	
Appendix A: DATA	8
Appendix B: PHOTOGRAPHS	14
LAST PAGE	18

2 Introduction

Intertek Testing Services NA (Intertek) has conducted testing for TPR² Corporation, on Heat Lok soy spray foam covered with 14mils of Fireshell F10E to evaluate heat release and flame spread properties when subjected to specific ignition conditions. Testing was conducted in accordance with NFPA 286 and AC 377 Appendix A comparing to PN (3161466-007) tested October 30, 2008. This was Agribalance™ and ¼" BC plywood that had fire out the door in 4:29 (min/sec). This evaluation was performed on October 30, 2008.

3 Test Samples

3.1. SAMPLE SELECTION

Samples were submitted to Intertek directly from the client. The spray foam was applied on the week of December 17, 2008.

3.2. SAMPLE AND ASSEMBLY DESCRIPTION

The test specimen consisted of three walls with 2x9 studs, 48 inches o.c. and 2x13 joists, 24 inches o.c. with a 15/32 inch plywood backing. The final interior dimensions were 8 feet high, 8 feet wide and 12 feet deep. Ceiling joists ran parallel to the short dimension of the room. The corner was constructed such that two studs met at their edges, forming a 90° angle.

On top of this substrate, the spray foam was applied to a thickness of 8 inches on the walls and 12 inches on the ceiling. There was no significant over spray outside of the cavities. The wall foam, studs, ceiling foam, and joists were covered with 14 mils of F10E intumescent coating.

See Photos in Appendix B for a visual depiction of the description.

4 Testing and Evaluation Methods

This standard describes a method for determining the contribution of textile wall and ceiling coverings to room fire growth during specified fire exposure conditions. This method is not intended to evaluate the fire endurance of assemblies, nor is it able to evaluate the effect of fires originating within the wall assembly. The method is not intended for the evaluation of floor finishes.

This method is to be used to evaluate the flammability characteristics of finish wall and ceiling coverings when such materials constitute the exposed interior surfaces of buildings. This test method does not apply to fabric covered less than ceiling height, freestanding, prefabricated panel furniture systems or demountable, relocatable, full-height partitions used in open building interiors. Freestanding panel furniture systems include all freestanding panels that provide

visual and/or acoustical separation and are intended to be used to divide space and may support components to form complete work stations.

This fire test measures certain fire performance characteristics of finish wall and ceiling covering materials in an enclosure under specified fire exposure conditions. It determines the extent to which the finish covering materials may contribute to fire growth in a room and the potential for fire spread beyond the room under the particular conditions simulated. The test indicates the maximum extent of fire growth in a room, the rate of heat release, and if they occur, the time to flashover and the time to flame extension beyond the doorway following flashover. It does not measure the fire growth in, or the contribution of, the room contents. Time to flashover is defined herein as either the time when the radiant flux onto the floor reaches 20 kW/m² or the temperature of the upper air reaches 600°C. A pair of crumpled single sheets of newspaper are placed on the floor 2 feet out from the center of the rear wall and front walls to determine flashover. The spontaneous ignition of this newspaper provides the visual indication of flashover.

The potential for spread of fire to other objects in the room, remote from the ignition source, is evaluated by measurements of:

1. The total heat flux incident on the center of the floor.
2. A characteristic upper-level gas temperature in the room.
3. Instantaneous net peak rate of heat release.

The potential for the spread of fire to objects outside the room of origin is evaluated by the measurement of the total heat release of the fire.

TEST EQUIPMENT AND INSTRUMENTATION

IGNITION SOURCE

The ignition source for the test is a gas burner with a nominal 12- by 12-inch porous top surface of a refractory material. The burner used at this laboratory is filled with a minimum 4-inch layer of Ottawa sand.

The top surface of the burner through which the gas is applied is positioned 12 inches above the floor, and the burner enclosure is located such that the edge of the diffusion surface is located 1 inch from both walls in the left corner of the room opposite from the door.

The gas supply to the burner is C.P. grade propane (99 percent purity). The burner is capable of producing a gross heat output of 40±1 for five minutes followed by a 160±5 kW for ten minutes. The flow rate is metered throughout the test. The design of the burner controls is such that when one quarter-turn ball valve is opened, the flow of gas to the burner produces 40 kW and when a second quarter-turn valve is opened the combined flow produces 160 kW.

COMPARTMENT GEOMETRY AND CONSTRUCTION

The interior dimensions of the floor of the fire room, when the specimens are in place, measures 8 feet, by 12 feet. The finished ceiling is 8 feet ± 0.5 inches above the floor. The four walls are at right angles defining the compartment. The compartment contains a 30 ± 0.25 by 80 ± 0.25

inch doorway in the center of one of the 8' by 8' walls. No other openings are present to allow ventilation.

PROCEDURE

SUMMARY OF METHOD

A calibration test is run within 30 days of testing any material as specified in the standard. All instrumentation is zeroed, spanned and calibrated prior to testing. The specimen is installed and the diffusion burner is placed. The collection hood exhaust duct blower is turned on and an initial flow is established. The gas sampling pump is turned on and the flow rate is adjusted. When all instruments are reading steady state conditions, the computer data acquisition system and video equipment is started. Ambient data is taken then the burner is ignited at a fuel flow rate that is known to produce 40 kW of heat output. This level is maintained for five minutes at which time the fuel flow is increased to the 160 kW level for a 10-minute period. During the burn period, all temperature, heat release and heat flux data is being recorded every 6 seconds. At the end of the fifteen minute burn period, the burner is shut off and all instrument readings are stopped. Post test observations are made and this concludes the test.

All damage is documented after the test is over, using descriptions, photographs and drawings, as is appropriate.

4.1. TEST STANDARD

NFPA 286 as defined AC 377 Appendix A.

5 Testing and Evaluation Results

5.1. RESULTS AND OBSERVATIONS

FIRE TESTS

The test was started at 11:30 am on January 15, 2009. The ambient temperature was 57°F with a relative humidity of 46%. The data acquisition system was started and the burner was ignited. Events during the test are described below:

TIME	
(min:sec)	OBSERVATION
0:00	Ignition of burner. Heat output set to 40 kW.
0:30	The walls began to discolor.
0:42	There is light smoke.
1:18	The side wall ignited.
1:42	Heavy smoke.
5:00	Burner was increased to 160 KW.
5:21	Flames are spreading horizontally at 4ft on back wall..
5:42	Flames spreading vertically and horizontally on back wall. (3 to 4ft)
5:54	Flame or at five foot on back wall..
6:04	Flames out the door.
6:42	Test terminated

Post Test Observations:

The intumescent and foam were heavily charred. Depth of a inch.

For additional details, see the post-test photographs later in this report.

6 Conclusion

The sample submitted, installed, and tested as described in this report displayed high levels of heat release, high upper level temperatures, and had flames exiting the test chamber. The heat flux on the floor did reach flashover levels. The sample did not spread flames to the ceiling during the 40 kW exposure.

NFPA 286 does not publish pass/fail criteria. One must consult the codes to determine pass fail.

This specimen **met** the criteria for ICC-ES AC377 Appendix A in comparison with PN(3161466-007) Agribalance™ foam covered with ¼" BC plywood on October 30, 2009 with the test being terminated with fire out the door 4:29 (min-sec).

INTERTEK TESTING SERVICES NA

Report



Troy Bronstad
Team Leader

Reviewed by:




C. Anthony Peñaloza
Flammability Testing Team Leader


APPENDIX A

Test Data


Thermocouple Data

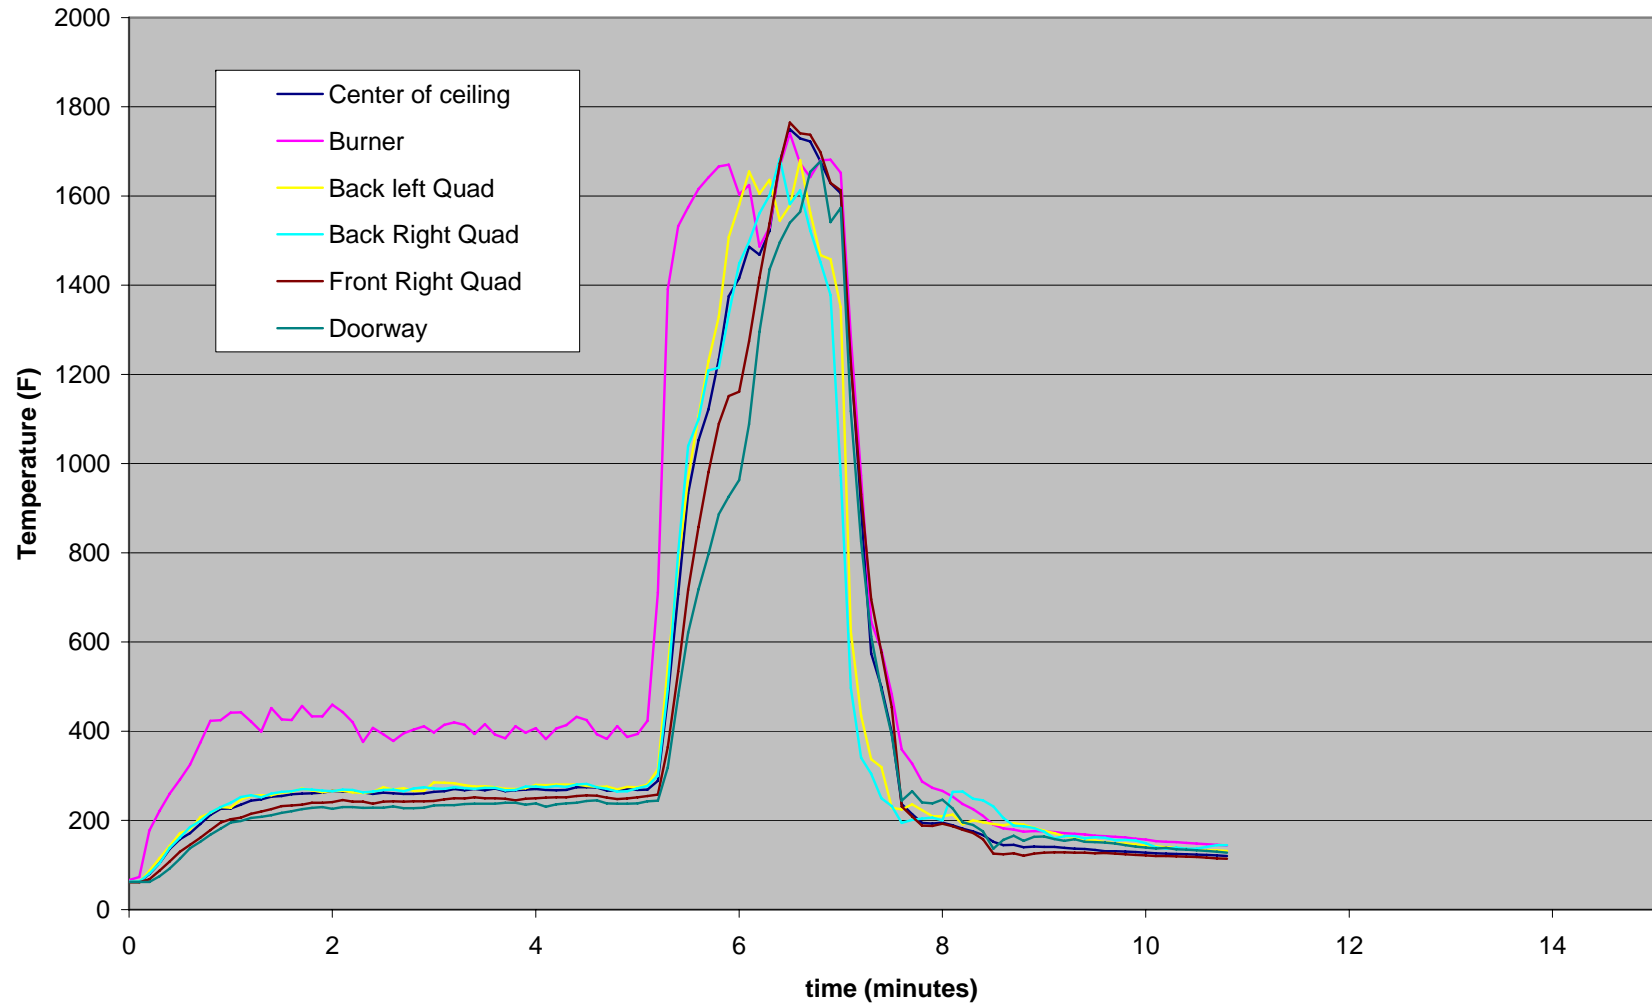


Smoke Release

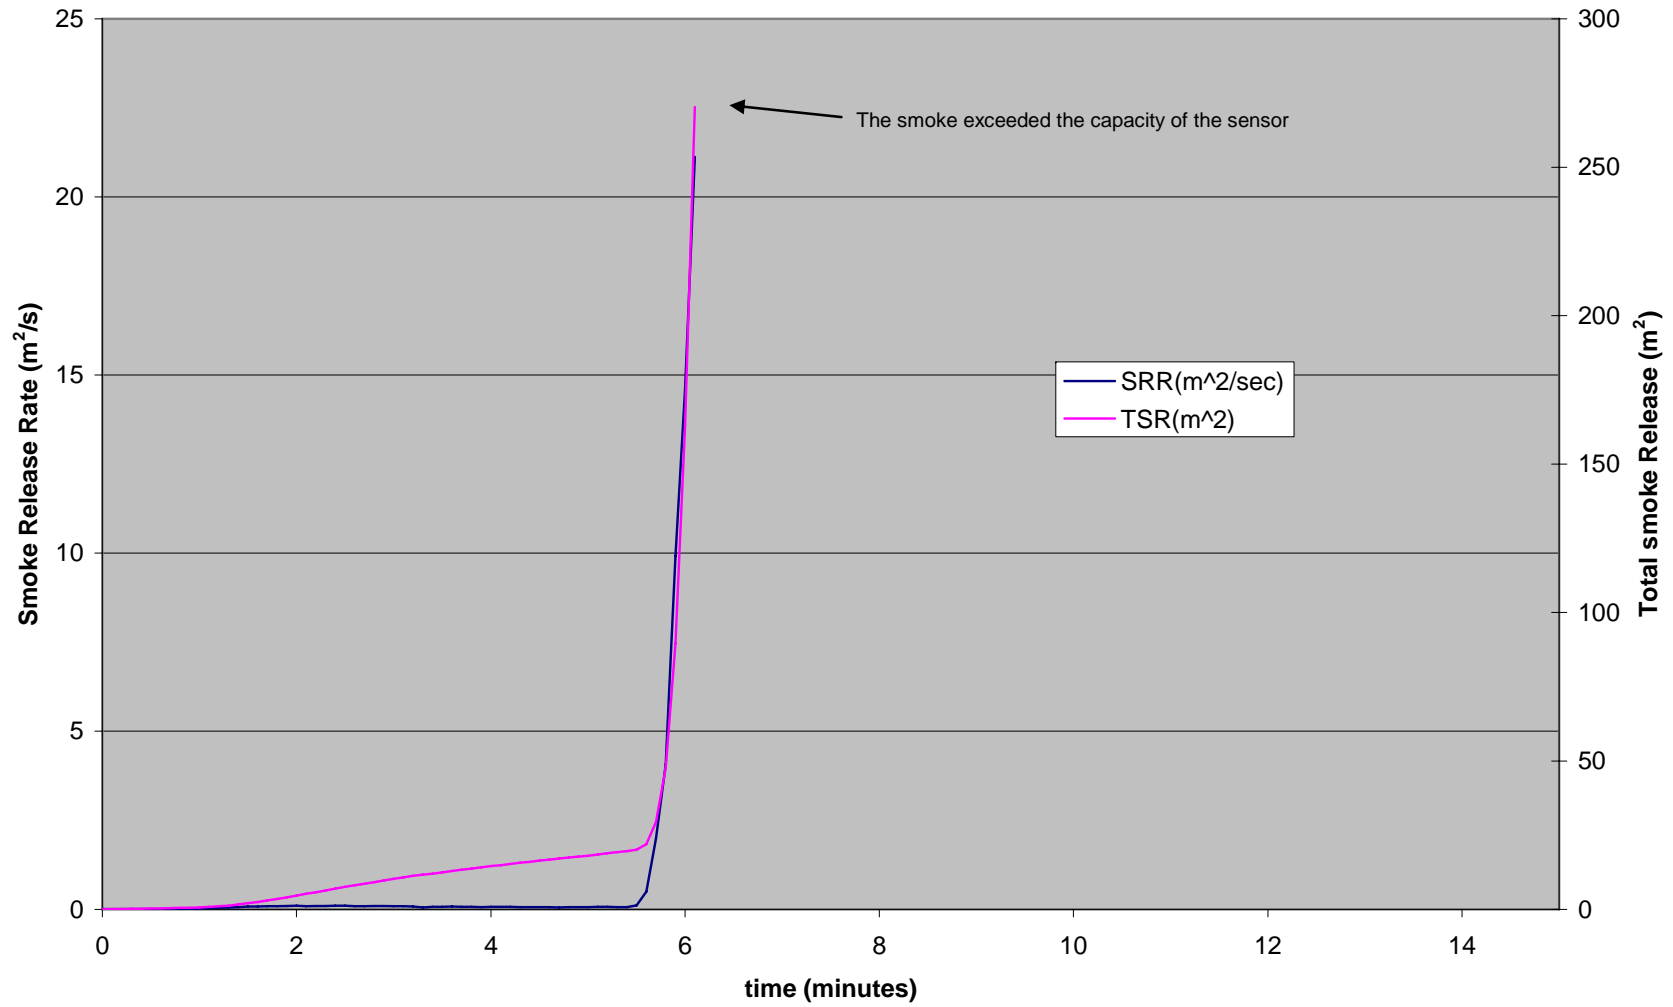

Heat Release

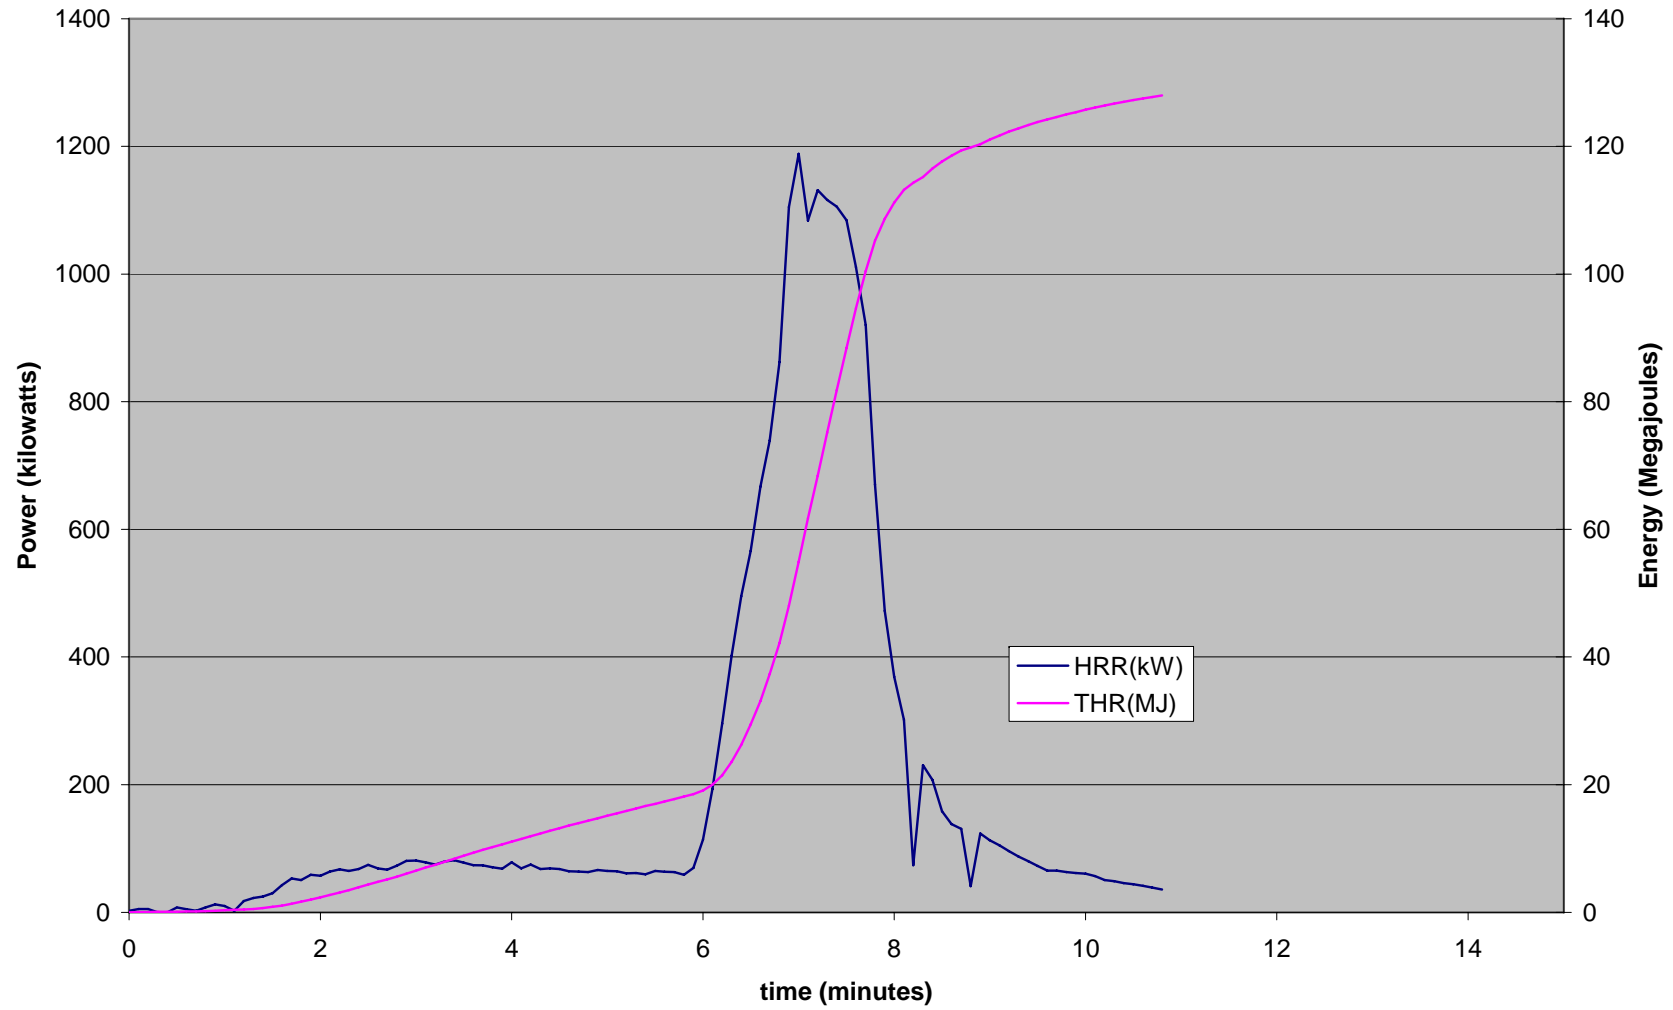

Radiant Heat

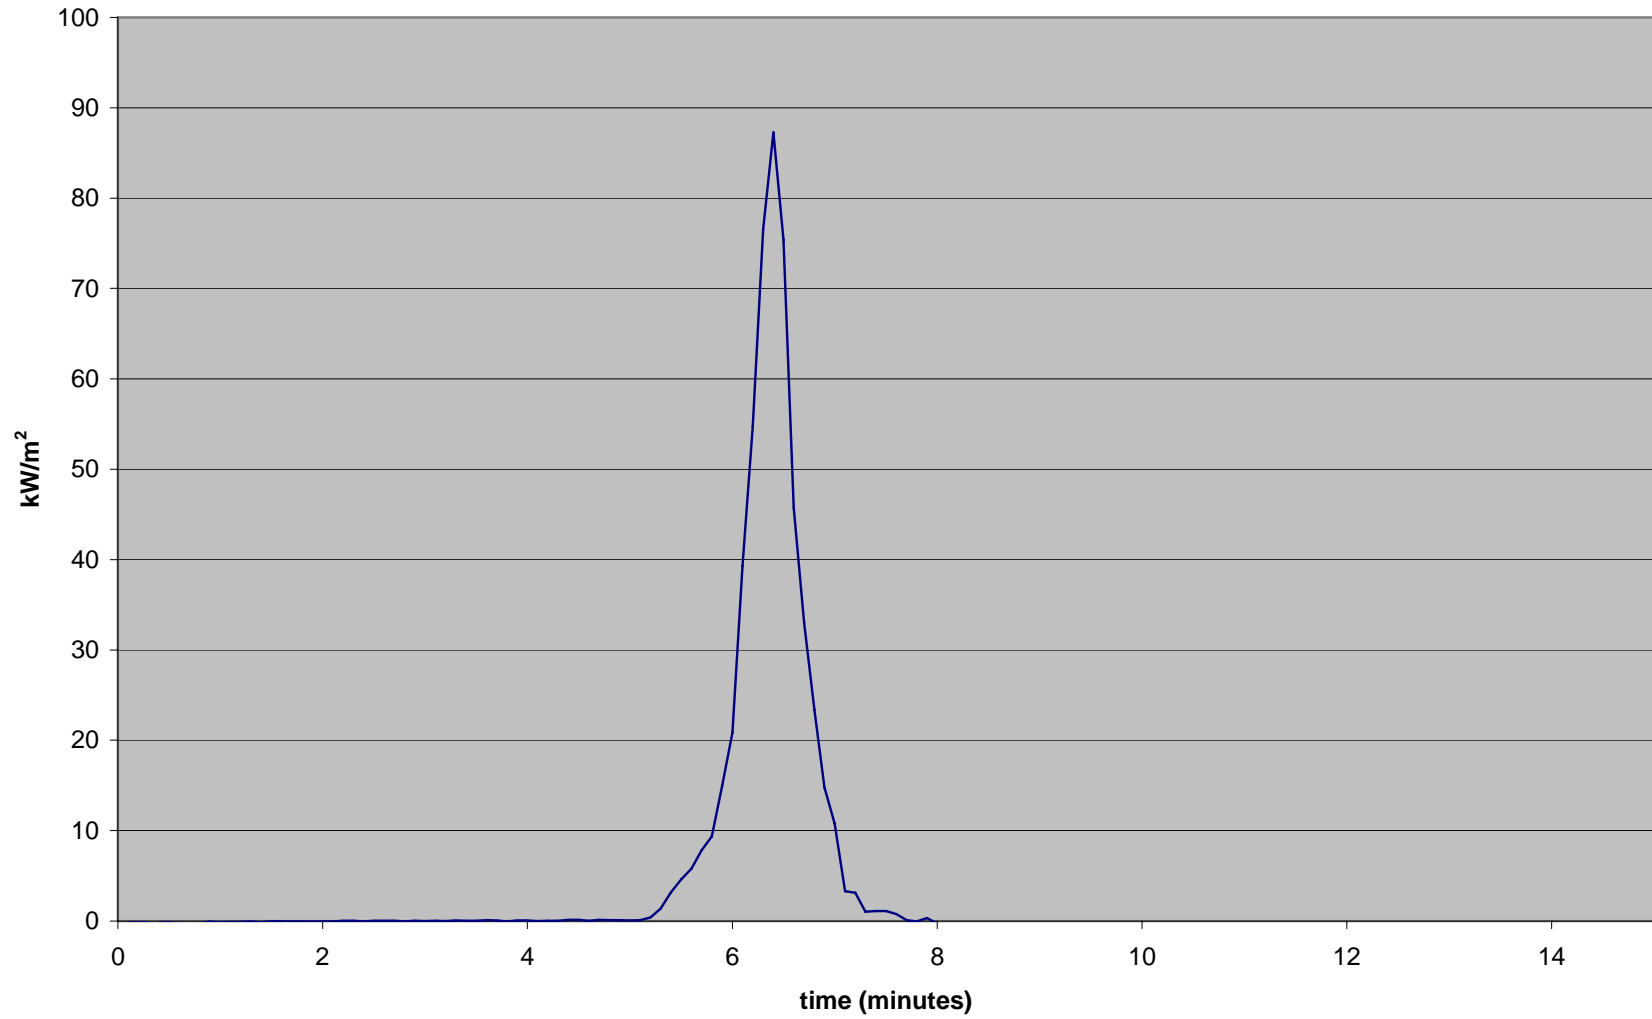

APPENDIX B

Photographs



Pre-test photo back wall



Pre-test photo ceiling



Start of test. 40kW



Test photo ignition.



Test photo.



Post-test photo



Post-test photo

LAST PAGE OF TEST REPORT

REVISION SUMMARY

DATE	SUMMARY
May 29, 2009	First issue. No revisions.